


ASSEMBLY & INSTALLATION INSTRUCTIONS

A568

Circular Solitude Pendant 139915

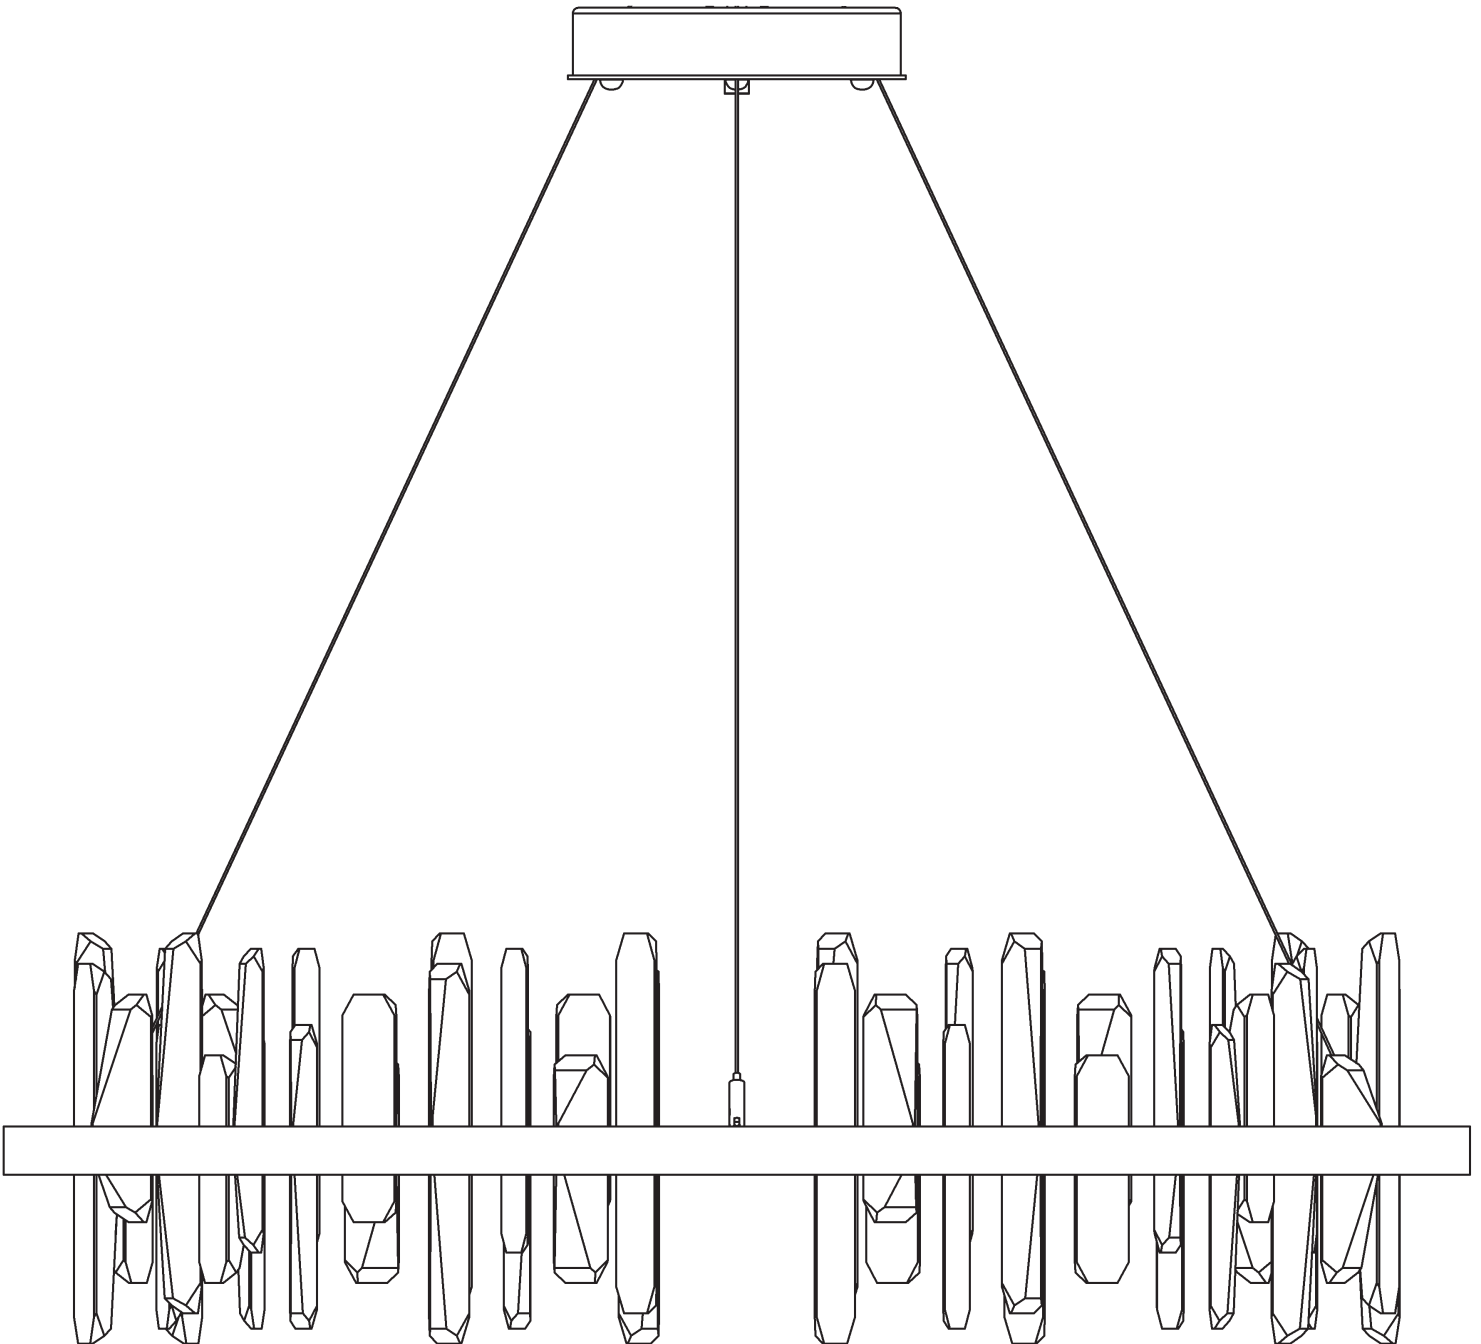

HUBBARDTON FORGE.


Component Parts

- A Canopy**
- B Cap**
- C Canopy Cover Plate**
- D #8 Screws (2)**
- E Gripper Plate**
- F Lag Screws (4)**
- G Fixture**
- H Gripper**
- I Supply/Support Cables (4)**
- J Safety cable**
- K Nut**
- L Crystal Accent (8)**

Please Note: After installation extra hardware and accessories are possible; our kits are used on multiple products.

CAUTION: BE SURE POWER IS OFF AT THE MAIN BREAKER BOX PRIOR TO INSTALLATION.

- CAUTION:** MAKE SURE WIRE CONNECTORS ARE TWISTED ON SECURELY AND NO BARE WIRE IS EXPOSED.

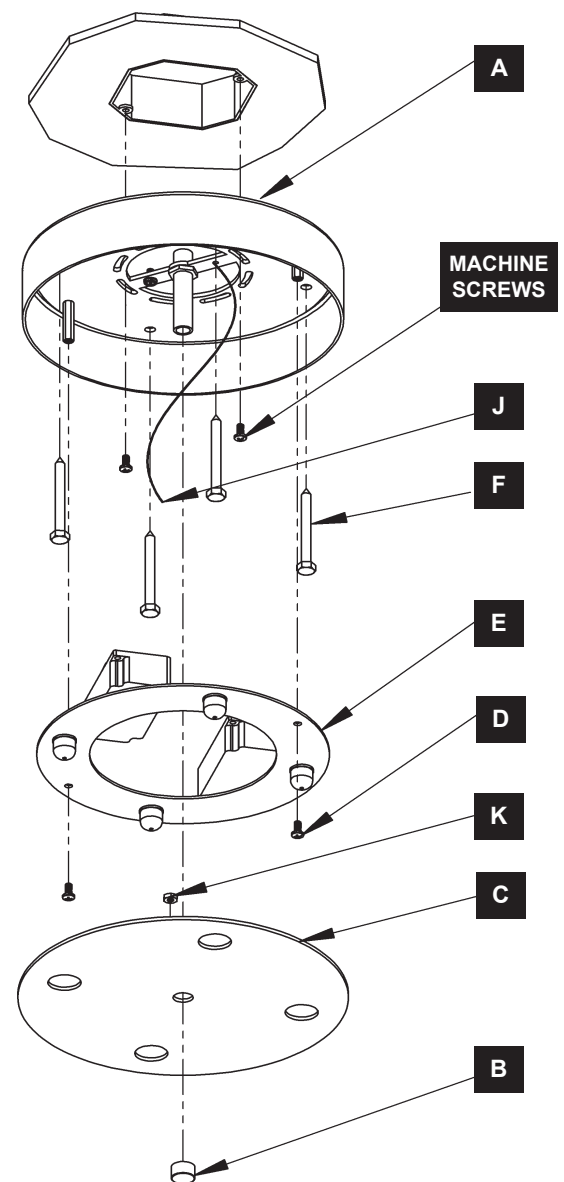

HF HUBBARDTON FORGE.

To Install Fixture (*continued*)

7. Feed safety cable (J) through the center hole in gripper plate (E). Reattach gripper plate to canopy (A) using two #8 screws (D).
8. Remove nut (K) from stud on canopy cover plate (C). Slide end of the safety cable (J) over the stud and reattach nut (K). The safety cable (J) also acts as the ground for the canopy cover plate (C).
9. Feed the supply/support cables (I) through appropriate holes in canopy cover plate (C), making sure that the (+) cables go through the (+) holes and the (-) cables go through the (-) holes. Install canopy cover plate (C) and secure in place with cap (B).
10. Align (+) and (-) labels on the fixture (G) with the (+) and (-) labels on canopy cover plate (C). **NOTE:** Only two cables are power cables, the two not marked with a (+) or (-) are support cables only.
11. Insert supply/support cable (I) through gripper (H) on fixture (G) until cable sticks through slot in the side of gripper.
12. Repeat step 12 for the remaining supply/support cables (I).
13. Raise fixture (G) to a comfortable height for installing accent pieces.
14. Follow instructions next to install crystals.



To Install Crystals

1. Locate crystal accent pieces (L) and white gloves. Place 2 accents (L) in each quadrant. Repeat for other 3 quadrants.


Note: Using white gloves while handling the crystals will prevent smudges.

2. Raise fixture to desired hanging height.
3. Once desired fixture height is achieved, cut excess cable (I) as close to the gripper (H) as possible.

CAUTION: Once excess cable is cut, fixture cannot be lowered.

CAUTION: Be sure no piece of the support cable is touching the fixture.

4. If needed, use the provided white gloves to polish the crystals.
5. Restore electricity at the main breaker.

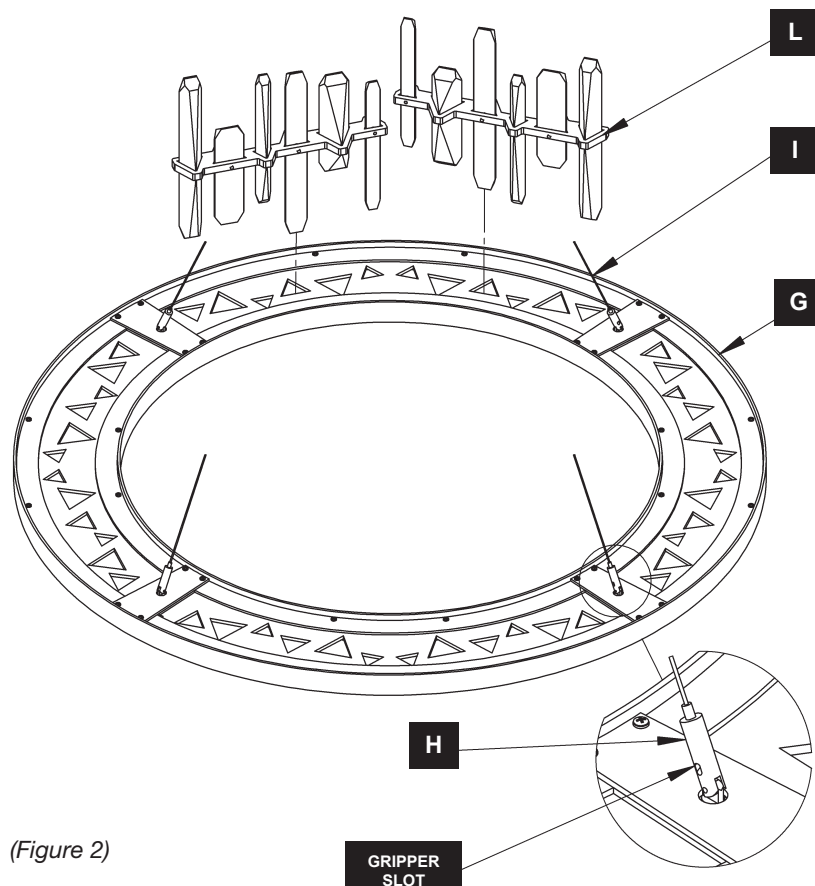

(Figure 2)

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!

*** Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.**